

C4222 Log Data Report

Borehole Information:

Borehole:	C4222		Site:	216-U-8 Crib	
Coordinates (WA State Plane)		GWL (ft) ¹ :	Dry	GWL Date:	03/15/2004
North	East	Drill Date	TOC ² Elevation	Total Depth (ft)	Type
Not Available	Not Available	March 2004	Not Available	50	Push Hole

Casing Information:

Casing Type	Stickup (ft)	Outer Diameter (in.)	Inside Diameter (in.)	Thickness (in.)	Top (ft)	Bottom (ft)
Threaded steel	+0.55	6 5/8	5 1/2	9/16	+0.55	50

Borehole Notes:

Zero reference is the ground surface. The logging engineer used a caliper to determine the outside casing diameter. The caliper and casing stickup were both measured using a steel tape. Inside casing diameter was measured with a steel tape. All measurements were rounded to the nearest 1/16 in.

Logging Equipment Information:

Logging System:	Gamma 1G		Type: SGLS (35%) 34TP10967A
Calibration Date:	01/2004	Calibration Reference:	GJO-2004-597-TAC
		Logging Procedure:	MAC-HGLP 1.6.5, Rev. 0

Spectral Gamma Logging System (SGLS) Log Run Information:

Log Run	1	2	3 / Repeat	
Date	03/15/04	03/15/04	03/15/04	
Logging Engineer	Spatz	Spatz	Spatz	
Start Depth (ft)	49.10	49.0	15.0	
Finish Depth (ft)	49.10	0	10.0	
Count Time (sec)	200	200	200	
Live/Real	R	R	R	
Shield (Y/N)	N	N	N	
MSA Interval (ft)	N/A ³	1.0	1.0	
ft/min	N/A	N/A	N/A	
Pre-Verification	AG047CAB	AG047CAB	AG047CAB	
Start File	AG048000	AG048001	AG048051	
Finish File	AG048000	AG048050	AG048056	
Post-Verification	AG048CAA	AG048CAA	AG048CAA	
Depth Return	N/A	-1"	0	

Log Run	1	2	3 / Repeat	
Error (in.)				
Comments	Sonde tip is just touching bottom of borehole.	No fine-gain adjustment made.	Repeat section.	

Logging Operation Notes:

Zero reference was ground surface. Logging was performed with a centralizer installed on the sonde. Preand post-survey verification measurements for the SGLS employed the Amersham KUT (40 K, 238 U, and 232 Th) verifier with serial number 118.

Analysis Notes:

SGLS pre-run and post-run verification spectra were collected at the beginning and end of the day. All of the verification spectra were within the acceptance criteria. The peak counts per second (cps) at the 609-keV, 1461-keV, and 2615-keV photopeaks on the post-run verification spectra as compared to the pre-run verification spectra for each day were between 1.1 percent lower and 1.2 percent higher at the end of the day. Examinations of spectra indicate that the detector functioned normally during logging, and the spectra are accepted.

Log spectra were processed in batch mode using APTEC SUPERVISOR to identify individual energy peaks and determine count rates. The post-run verification spectra were used to determine the energy and resolution calibration for processing the data using APTEC SUPERVISOR. Concentrations were calculated in EXCEL (source file: G1GJan04.xls). Zero reference was the ground surface. Based on the field measurements, the casing configuration was assumed as one string of 6-in. casing with a thickness of 9/16 in. to 49.1 ft (total logging depth). Dead time and water corrections were not required.

Log Plot Notes:

Separate log plots are provided for gross gamma and dead time, naturally occurring radionuclides (40 K, 238 U, and 232 Th), and man-made radionuclides. Plots of the repeat logs versus the original logs are included. For each radionuclide, the energy value of the spectral peak used for quantification is indicated. Unless otherwise noted, all radionuclides are plotted in picocuries per gram (pCi/g). The open circles indicate the minimum detectable level (MDL) for each radionuclide. Error bars on each plot represent error associated with counting statistics only and do not include errors associated with the inverse efficiency function, dead time correction, or casing correction. These errors are discussed in the calibration report. A combination plot is also included to facilitate correlation. The 214 Bi peak at 1764 keV was used to determine the naturally occurring 238 U concentrations on the combination plot rather than the 214 Bi peak at 609 keV because it exhibited slightly higher net counts per second.


Results and Interpretations:

Man-made radionuclides were not detected in this borehole.


The plots of the repeat logs demonstrate reasonable repeatability of the SGLS data for the natural radionuclides at energy levels of 609, 1461, 1764, and 2614 keV.

¹ GWL – groundwater level ² TOC – top of casing ³ N/A – not applicable


C4222

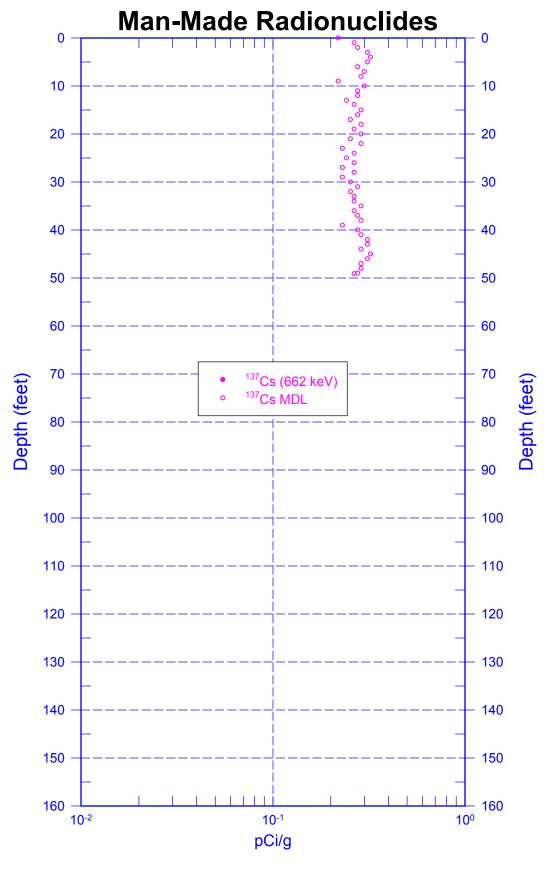


C4222 Natural Gamma Logs

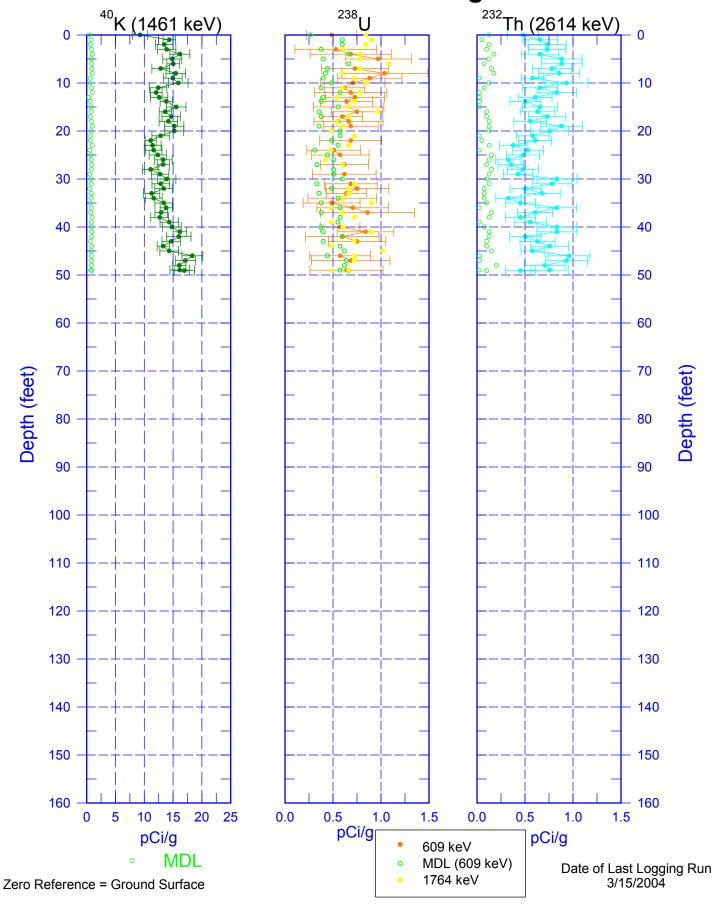


C4222 Combination Plot

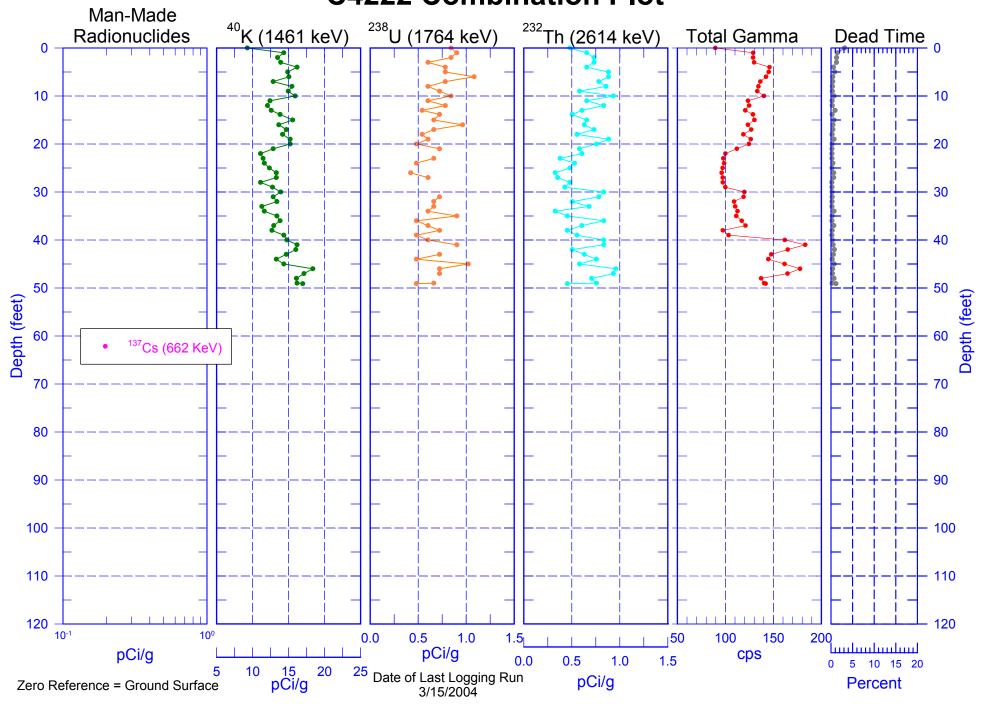

C4222 Combination Plot

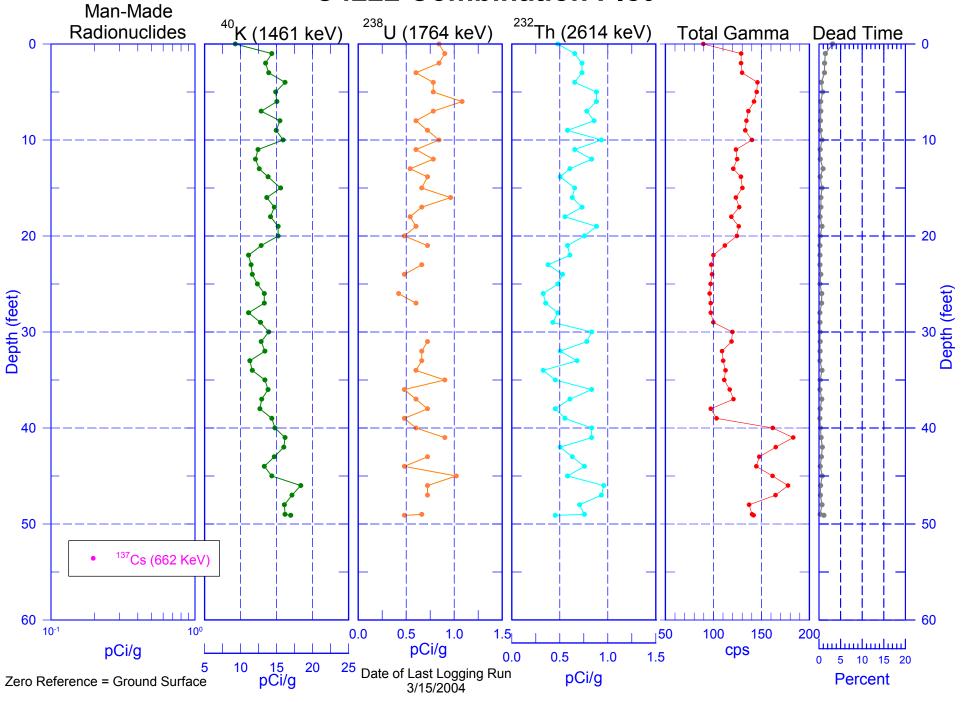

C4222
Total Gamma & Dead Time

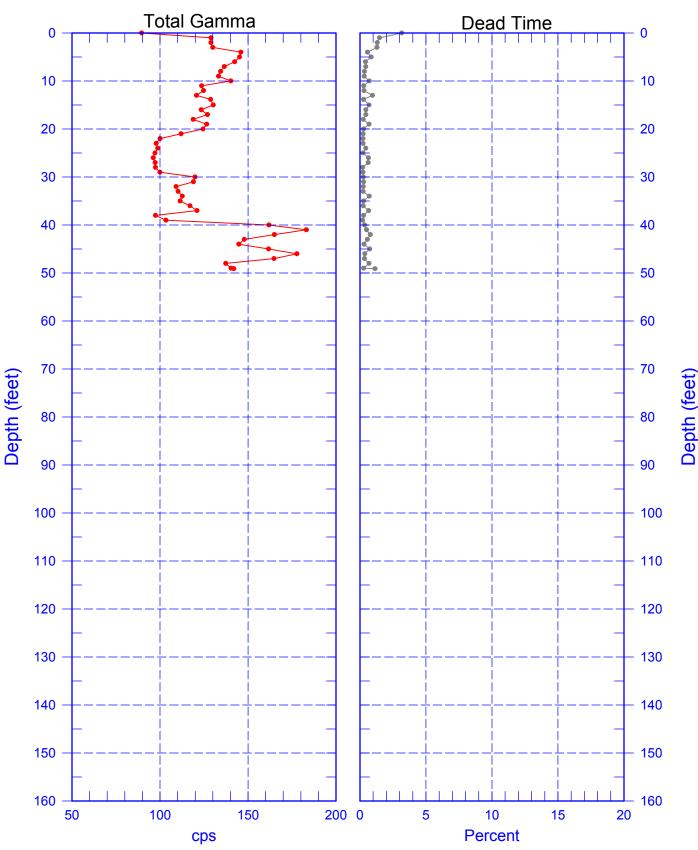

Zero Reference = Ground Surface Date of Last Logging Run 3/15/2004

C4222
Rerun of Natural Gamma Logs (15.0 to 10.0 ft)

